

655 Eisenhower Drive Owatonna, IVIN 00000 Phone: (507) 455-7000 Tech. Serv.: (800) 533-6127 Fax: (800) 955-8329

Order Entry: (800) 533-6127 Fax: (800) 283-8665

International Sales: (507) 455-7290

Fax: (507) 455-7063

### **Operating Instructions** for:

(511549)

6481

# Ford Camshaft Holding Tool

Application: 1997 – 2011 4.0L SOHC Explorer, Mountaineer, Ranger (VIN E)

1997 – 2008 4.0L SOHC Explorer, Mountaineer, Ranger (VIN X)

2005 – 2010 4.0L SOHC Mustang (VIN N)

# (511549)No. 6480 (511548)

No. 6481

#### NOTE:

- Same as Ford No. 303-577 (T97T-6256-C).
- This tool is used with No. 6480 (511548) Ford Camshaft Holding Tool Adapter.
- 1. Install tool Nos. 6480 (511548) and 6481 (511549) on the camshaft as shown.
- 2. Secure tool No. 6481 (511549) to the cylinder head.
- 3. Service the timing chain as required according to instructions in the vehicle service manual.
- 4. Torque fasteners to factory specifications.



**WARNING:** Wear eye protection that meets ANSI Z87.1 and OSHA standards.

© Bosch Automotive Service Solutions LLC July 25,2014 Rev. C



655 Eisenhower Drive Owatonna, MN 55060 USA Phone: (507) 455-7000

Tech. Serv.: (800) 533-6127 Fax: (800) 955-8329 Order Entry: (800) 533-6127 Fax: (800) 283-8665

International Sales: (507) 455-7290

Fax: (507) 455-7063

Form No. 107105

**Operating Instructions** for:


6481 (511549)

# Ford Camshaft Holding Tool

Application: 1997 – 2011 4.0L SOHC Explorer, Mountaineer, Ranger (VIN E)

1997 – 2008 4.0L SOHC Explorer, Mountaineer, Ranger (VIN X)

2005 – 2010 4.0L SOHC Mustang (VIN N)

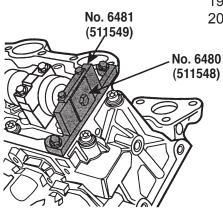

- Same as Ford No. 303-577 (T97T-6256-C).
- This tool is used with No. 6480 (511548) Ford Camshaft Holding Tool Adapter.
- 1. Install tool Nos. 6480 (511548) and 6481 (511549) on the camshaft as shown.
- 2. Secure tool No. 6481 (511549) to the cylinder head.
- 3. Service the timing chain as required according to instructions in the vehicle service manual.
- 4. Torque fasteners to factory specifications.



**WARNING:** Wear eye protection that meets ANSI Z87.1 and OSHA standards.